


Home Report



Walker Fraser Steele
Chartered Surveyors

Single Survey

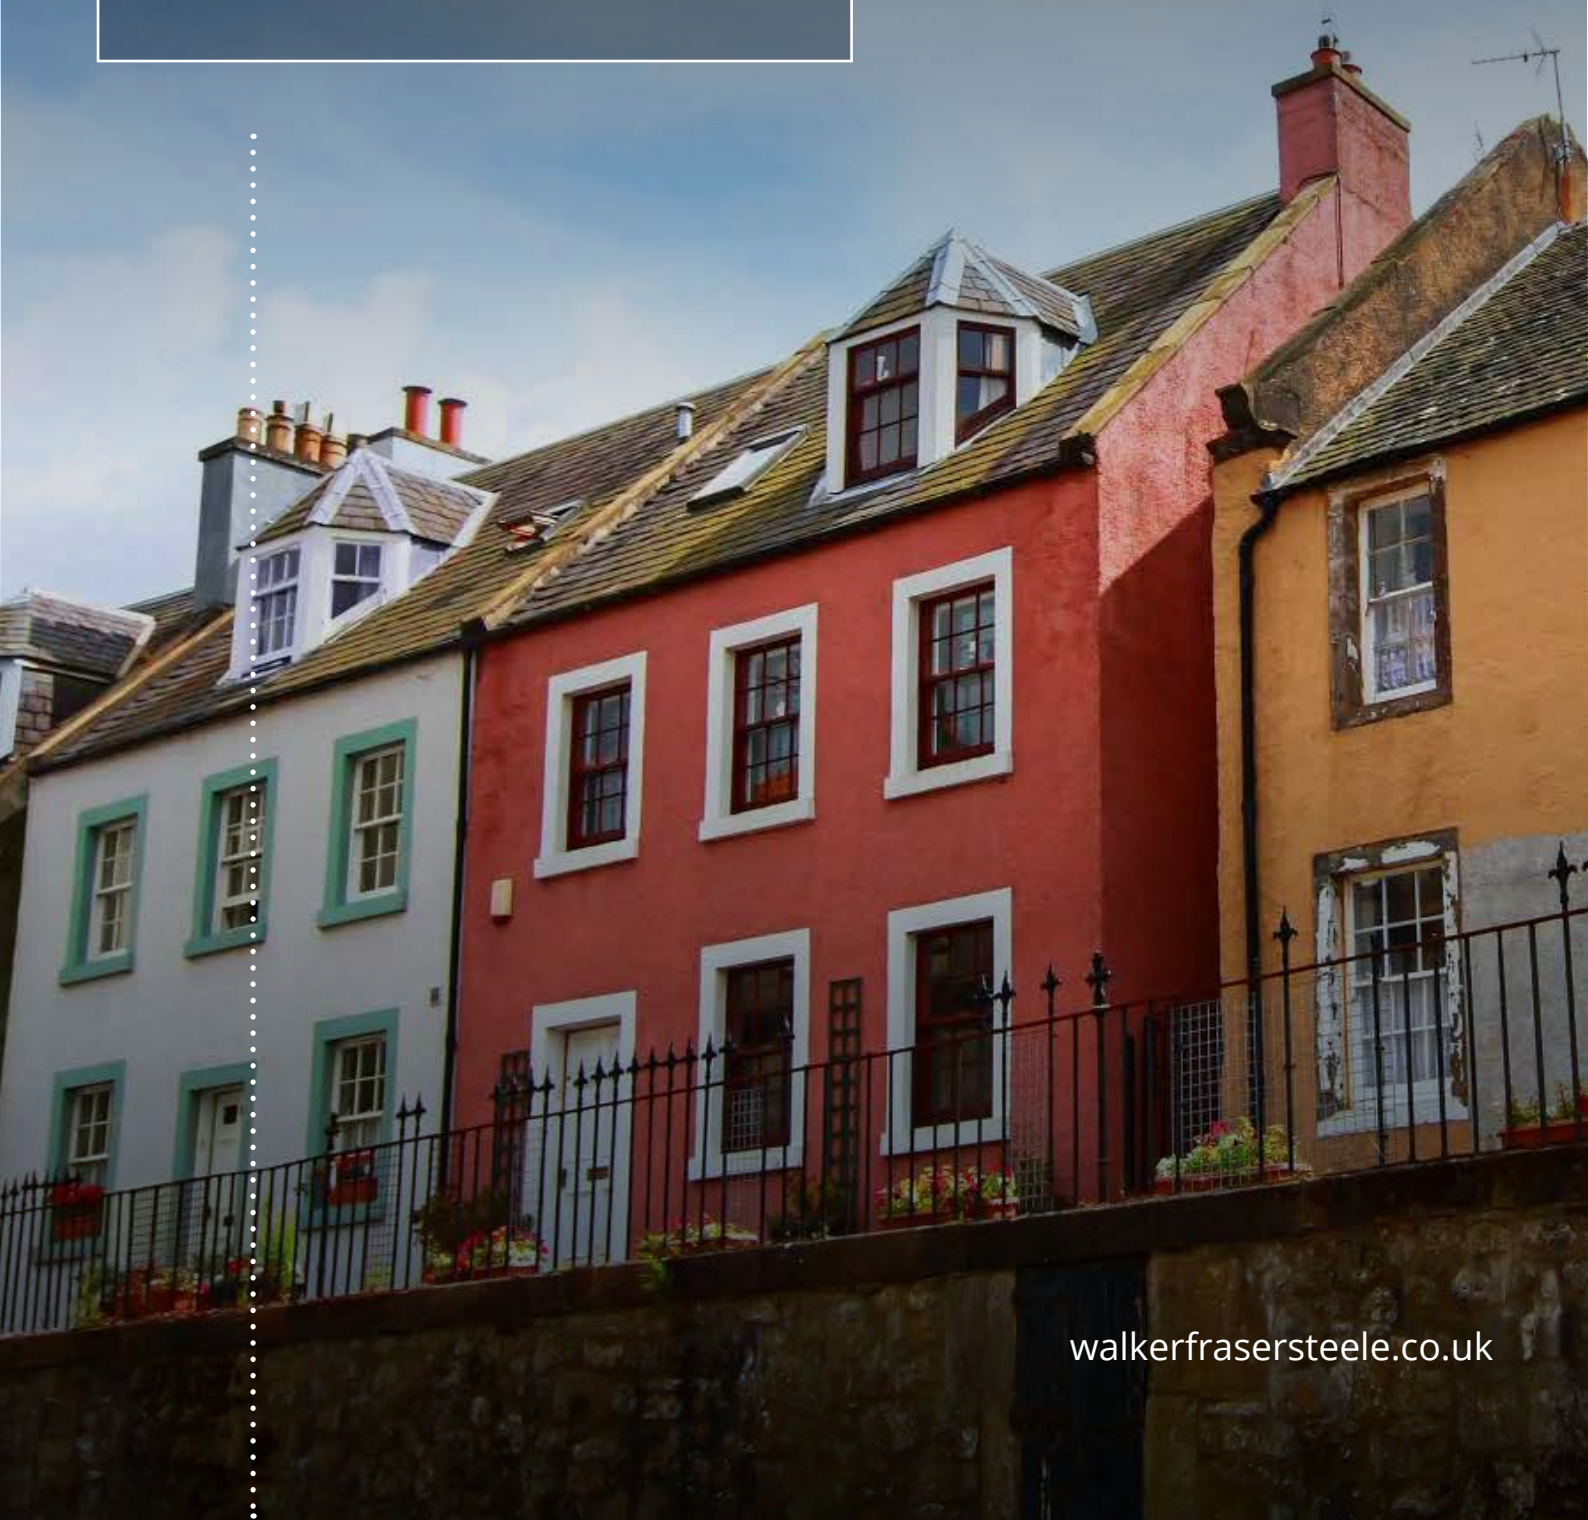

Single Survey

Property Address	Harbour Cottage Shore Street Helmsdale KW8 6JZ
Customer	Jamie McLean & Michaela McLean
Date of Inspection	05/05/2026
Prepared by	Jennifer Swanson Walker Fraser Steele

TERMS AND CONDITIONS

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who will have sufficient current local knowledge of the particular market to competently survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by checking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3

LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential Surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4

GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5

TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6

INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7

PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8

CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as

detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

¹Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

²Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is

made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The property comprises a detached three bedroom house, over two floors, with attached single garage, set in an area of garden ground
Accommodation	Ground Floor: Hall, Sitting room, Bedroom)with en-suite Shower room facilities and Kitchen/Dining room First Floor: Landing, two Bedrooms and Bathroom
Gross internal floor area (sqm)	110 or thereby
Neighbourhood and location	The property is set a short distance back from Shore Street, close to the Harbour, in the village of Helmsdale, approximately seventeen miles north east of Golspie. The property is within walking distance of primary school, shops and a limited range of other amenities. Enhanced facilities including secondary school can be found in Golspie.
Age	Built 1815
Weather	At the time of the inspection, it was dry.
Chimney stacks	Visually inspected with the aid of binoculars where required. There are two stone chimney stacks which are slaistered/rendered externally with mortar flashing, stone copes and fireclay pots

Roofing including roof space	<p>Sloping roofs were visually inspected with the aid of binoculars where required.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defines as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>Roofs are prone to water penetration in extreme storms but it is not always possible for surveyors to identify this likelihood in good or dry weather. All slated roofs in particular should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</p> <p>The main roof is pitched, timber framed, timber sarked and slate clad with lead ridging and stones skews. Skylights and timber framed slate clad dormers have been let into the roof on both elevations. Insulation has been fitted in the main roof space at the joists. Access to the main roof space was via a ceiling hatch in the Landing.</p> <p>The roof over the Kitchen/Dining room is mono pitched in a lean to fashion to the main roof with lead flashing and stone skews. Insulation has been fitted in the roof space of the Kitchen/Dining room at the joists. Access to this roof space was via a ceiling hatch in the Kitchen/Dining room,</p>
Rainwater fittings	<p>Visually inspected with the aid of binoculars where required.</p> <p>Rainwater fittings are formed in plastic and cast iron.</p>
Main walls	<p>Visually inspected with the aid of binoculars where required.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The main walls are solid stone construction and roughcast on the outer face.</p> <p>The type of damp-proof course to the main walls cannot be ascertained.</p>

<p>Windows, external doors and joinery</p>	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible. Doors and windows were not forced open.</p> <p>The windows are double glazed with wood grained effect upvc casements.</p> <p>The external doors are of similar manufacture.</p> <p>The fascia at the Kitchen/Dining room projection are formed in timber.</p>
<p>External decorations</p>	<p>Visually inspected</p> <p>The external joinery has a paint finish. The walls are finished in masonry paint. The cast iron rainwater goods have a paint finish.</p>
<p>Conservatories / porches</p>	<p>None</p>
<p>Communal areas</p>	<p>None</p>
<p>Garages and permanent outbuildings</p>	<p>Visually inspected</p> <p>There is an attached single garage of part concrete block part timber construction under a flat roof clad in mineral felt.</p> <p>There are timber framed and panelled vehicle access doors to the front. There is a timber access door to the side and a single glazed timber casement window to the rear. There is a power and light supply.</p>
<p>Outside areas and boundaries</p>	<p>Visually inspected</p> <p>The garden grounds are to the front rear and side of the property. They are mainly hard landscaped with paved patio and gravel, flower beds, raised beds, shrubbery and small trees. The grounds to the rear are terraced with a section behind a small retaining wall. The boundaries are enclosed by a mix of stone walls, masonry walls and masonry retaining walls.</p> <p>The oil tank is located in the rear gardens.</p>
<p>Ceilings</p>	<p>Visually inspected from floor level</p> <p>The ceilings are timber framed and faced with plasterboard which has been taped and filled. Some ceilings are timber lined. Some ceilings have a textured coating. The ceilings at first floor level are gently coombed.</p>

Internal walls	<p>Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>The internal walls and partitions are timber framed and faced with plasterboard which has been taped and filled. Some internal walls are plastered on the hard. Sections of internal wall in the Shower room are wet wall lined. Some sections of internal walls are timber clad.</p>
Floors including sub floors	<p>Surface of exposed floors were visually inspected. No carpets or floor covering were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted “head and shoulders” inspection at the access point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>The floors at ground level are solid concrete construction. At first floor level the floors are suspended timber construction.</p> <p>It is for note there is a difference in floor level between the Kitchen/Dining room and the rest of the property.</p>
Internal joinery and kitchen fittings	<p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>Standard modern joinery has been fixed throughout and proprietary kitchen units have been fitted.</p>
Chimney breasts and fireplaces	<p>Visually inspected. No testing of the flues or fittings was carried out.</p> <p>The chimney breast is formed in stone and faced with plasterboard. There is an open fireplace in the Sitting room on a tiled hearth with a tiled surround and timber mantle.</p> <p>Any additional fireplaces have been removed and the openings sealed.</p>
Internal decorations	<p>Visually inspected</p> <p>The walls and ceilings are finished in emulsion. The internal joinery has a paint/varnish finish.</p>


Cellars	None
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p> <p>Mains grid supplied electricity. The visible cabling is PVC sheathed and 13 Amp power points have been fitted. The consumer unit and meter are located in a Hall cabinet.</p>
Gas	None
Water, plumbing and bathroom fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Mains supply water. The distribution pipes are in copper and PVC. Ceramic sanitary fittings have been fixed. The hot water cylinder is located in the garage.</p>
Heating and hot water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Central heating is provided by an oil fired boiler to wall mounted radiators. Hot water is provided from the same source. The boiler is located in the garage. Space heating is supplemented by the open fire in the Sitting room.</p>
Drainage	<p>Drainage covers etc were not lifted. Neither drains nor drainage system were tested.</p> <p>Drainage is assumed to connect into the public sewer.</p>

Fire, smoke and burglar alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There are smoke alarms located in Hall, Sitting room and in the Landing.</p> <p>There is a carbon monoxide alarm located in the Sitting room.</p> <p>There is a heat alarm located in the Kitchen/Dining room.</p> <p>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</p> <p>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</p>
---------------------------------------	---

<p>Any additional limits to inspection</p>	<p>When visually inspected the property insulation was not disturbed, furniture and personal effects (particularly in cupboards) and floor coverings have not been moved.</p> <p>Access to the roof void was limited to a head and shoulders only inspection due to space restrictions.</p> <p>The inspection of the roof timbers was restricted due to insulation laid at the joists.</p> <p>The inspection of and moisture meter readings were restricted in part due to furniture placement and storage of personal belongings.</p> <p>One Bedroom cupboard, at first floor level, was locked and therefore no inspection was undertaken.</p> <p>In areas where no inspection was possible, the surveyor has assumed there are no defects that have a material effect on the valuation.</p> <p>In a property of this age and type it is possible that there may be structural defects which are presently concealed by floor coverings, plasterwork etc., and in view of the problems noted there may be further latent defects in areas which are presently inaccessible.</p> <p>There is a possibility that asbestos may be present within components and fittings of properties built prior to the year 2000. It is impossible to positively identify asbestos without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask a specialist to undertake an appropriate test.</p> <p>We have not made checks to ascertain whether the property lies within a Radon area. Further advice should be sought from the National Radiological Protection Board.</p> <p>There is a river located close to the property. As of 6th May 2026 the online SEPA flood risk map indicates that there is a high river flood risk within approx a 25 metre distance from the property address. We have assumed there are no issues in this regard, that the property has never suffered from flooding and that insurance can be obtained on normal terms. Should any of these assumptions prove to be incorrect, it could impact on the value reported herein and future saleability of the property and we would recommend that further checks are made prior to purchase in this regard.</p> <p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p>
---	--

	<p>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.</p>
--	--

Sectional Diagram showing elements of a typical house

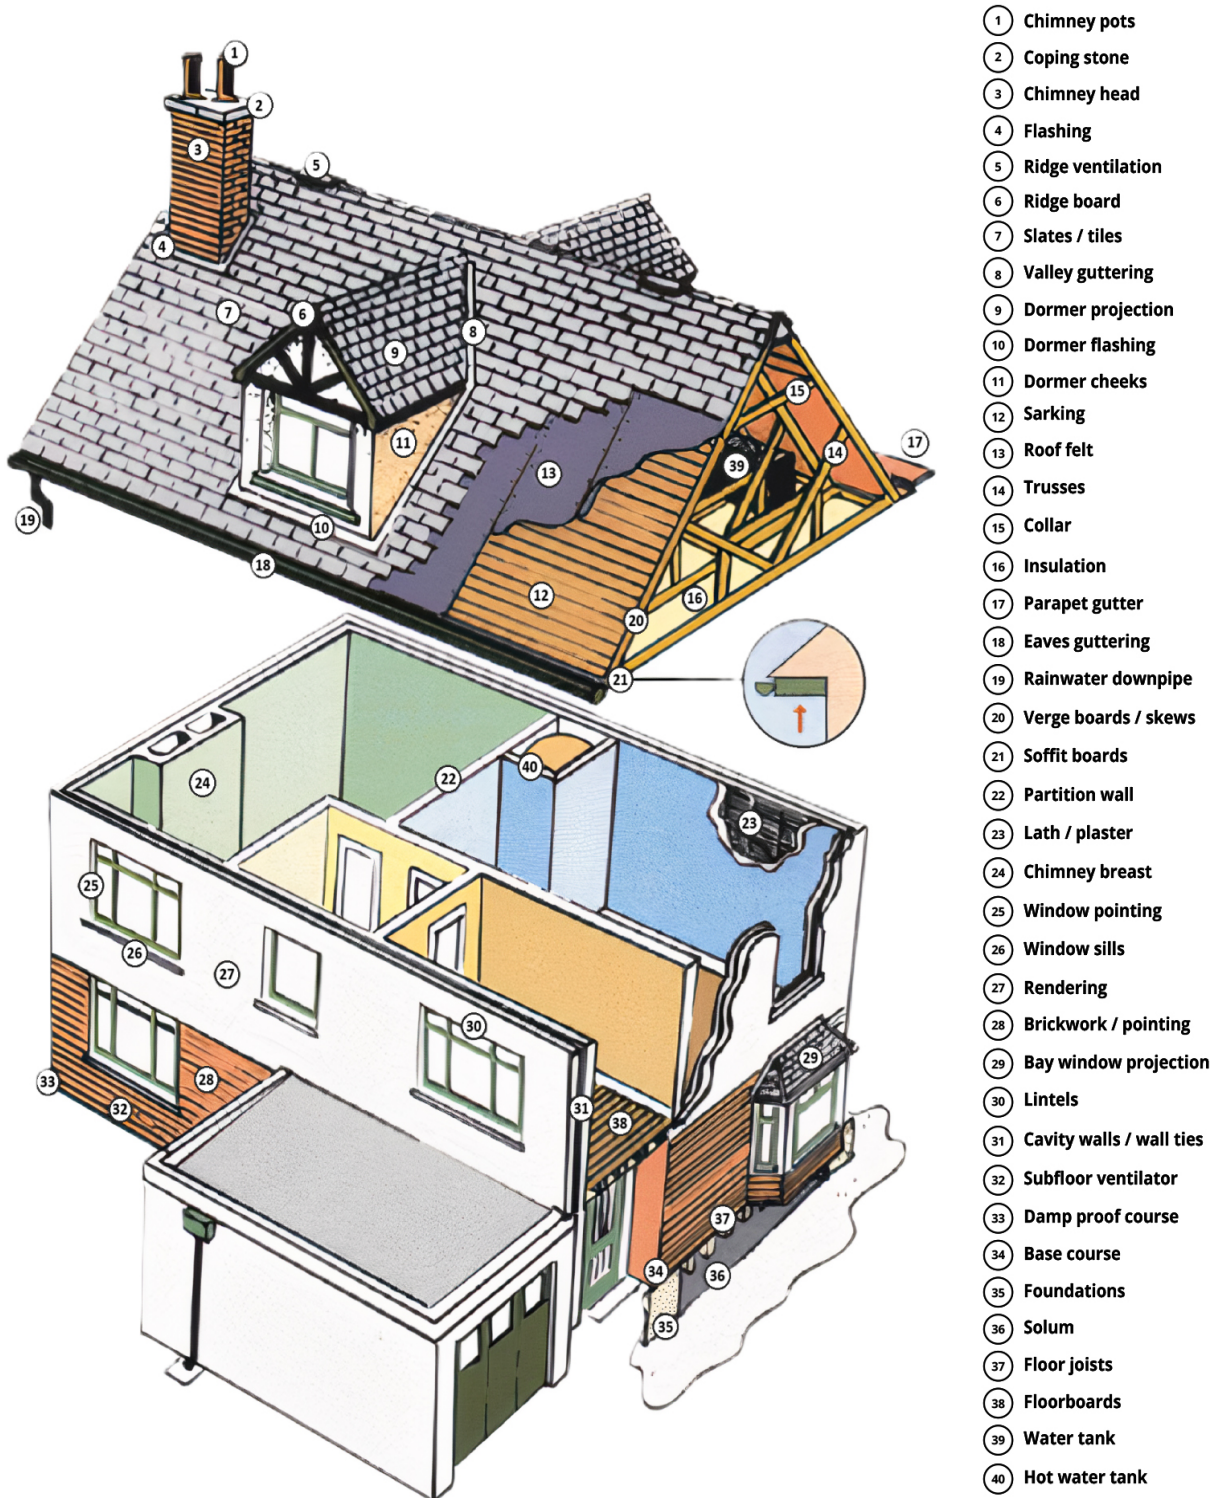

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 1 1	Category 2 2	Category 3 3
No immediate action or repair is needed.	Repairs or replacement requiring future attention, but estimates are still advised.	Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Structural movement	
Repair category:	1
Notes	Evidence of previous movement was noted in the form of cracking to roughcast to the front and rear elevations but, within the limitations of my inspection, there was no evidence that the movement was recent or serious. Further significant movement would seem unlikely although on the basis of a single inspection cannot be positively excluded

Dampness, rot and infestation	
Repair category:	3
Notes	High and elevated moisture meter readings were noted to internal walls and floor in the under stair cupboard of the ground floor Bedroom and to internal walls and floor in the Kitchen/Dining room. Prolonged dampness increases the risk of timber defects and deterioration to other parts of the building. It is recommended that a reputable timber/damp specialist firm be employed to carry out a detailed inspection of the entire subjects

Chimney stacks	
Repair category:	2
Notes	There is cracking to render of one of the stacks. There is vegetation growth to the cope of one of the stacks.

Roofing including roof space	
Repair category:	2
Notes	<p>Condensation staining was noted to timbers in the main roof space.</p> <p>Slipped and cracked/chipped slates were noted.</p> <p>Given the age of the roof covering regular routine maintenance should be anticipated. A competent roofing contractor should be instructed to inspect the roofs and carry out all appropriate repairs and provide advice on future repair/replacement liabilities.</p>

Rainwater fittings	
Repair category:	2
Notes	<p>There is some damage to rainwater gutters on the front elevation at the Kitchen/Dining room.</p> <p>Corrosion was noted to areas of cast iron goods.</p> <p>We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy rainfall in order to ensure they are free from defect.</p>

Main walls	
Repair category:	2
Notes	<p>Cracking was noted to both elevations. Cracked roughcast requires to be filled with flexible sealant to prevent water penetration and frost deterioration.</p>

Windows, external doors and joinery	
Repair category:	2
Notes	<p>Timber decay was noted to the fascia.</p> <p>Windows were not all fully opened or tested however some items of wear and tear including weathering were visible and repairs or replacement of units and/or components may be required.</p> <p>Windows were not all fully opened or tested and it should be appreciated that some defects are only evident during certain weather conditions.</p>

External decorations	
Repair category:	2
Notes	Paintwork at external timber components is weathered/peeling. Paintwork at areas of external walls is weathered/peeling.

Conservatories / porches	
Repair category:	
Notes	Not Applicable

Communal areas	
Repair category:	
Notes	Not Applicable

Garages and permanent outbuildings	
Repair category:	1
Notes	Elements of the construction are of rudimentary design and as such a higher degree of ongoing maintenance will be required.

Outside areas and boundaries	
Repair category:	2
Notes	Outside areas are suffering from a lack of maintenance/attention. Cracking and wear and tear was noted to boundary walls. Boundary walls should be regularly checked and maintained as necessary. It is for note that there is a redundant oil tank in the garden grounds.

Ceilings	
Repair category:	1
Notes	It is understood that textured ceilings have been tested by a specialist and that there is no asbestos content. Checks should be made to verify this.

Internal walls	
Repair category:	3
Notes	High and elevated moisture meter readings were noted to internal walls in the under stair cupboard of the ground floor Bedroom and to walls in the Kitchen/Dining room. Prolonged dampness increases the risk of timber defects and deterioration to other parts of the building. It is recommended that a reputable timber/damp specialist firm be employed to carry out a detailed inspection of the entire subjects

Floors including sub floors	
Repair category:	3
Notes	<p>High and elevated moisture meter readings were noted to floors in the under stair cupboard of the ground floor Bedroom and to floors in the Kitchen/Dining room. Prolonged dampness increases the risk of timber defects and deterioration to other parts of the building. It is recommended that a reputable timber/damp specialist firm be employed to carry out a detailed inspection of the entire subjects</p> <p>Sections of the floor in the Kitchen/Dining room have warped and are uneven.</p> <p>Sections of flooring at first floor level are uneven and there is a slight slope.</p> <p>A threshold strip is missing from an open doorway on the Landing.</p>

Internal joinery and kitchen fittings	
Repair category:	1
Notes	<p>General wear and tear was noted to internal joinery and Kitchen fittings.</p> <p>At the time of inspection the integrated door to the fridge was not attached.</p> <p>There are no visible British Standard marks to the internal glazing of some doors suggesting that it is not safety glass and does not meet current standards.</p>

Chimney breast and fire places	
Repair category:	1
Notes	<p>The fireplace is in reasonable condition and appears to be free from significant defect. It should be ensured that all flues, whether in use or not, are kept in a sound condition and are regularly checked and serviced. Flues which are in use would benefit from a regular smoke test.</p> <p>Where additional fireplaces have been removed and the openings sealed is it assumed they have been adequately capped and vented.</p>

Internal decorations	
Repair category:	1
Notes	Internal decoration is generally acceptable although some wear and tear is evident in places.

Cellars	
Repair category:	
Notes	Not Applicable

Electricity	
Repair category:	2
Notes	<p>I have not been advised of a recent test certificate being available.</p> <p>The installation, within the house and the garage, appears to be of mixed eras.</p> <p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC / SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IEE regulations.</p>

Gas	
Repair category:	
Notes	Not Applicable

Water, plumbing and bathroom fittings	
Repair category:	1
Notes	<p>Some wear and tear is noted to the bathroom fittings.</p> <p>There are no obvious defects affecting the visible plumbing apparatus.</p> <p>No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted.</p>

Heating and hot water

Repair category:	1
Notes	<p>It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations. It would be prudent to make checks on the service history.</p> <p>At the time of inspection, the heating system was not operating and we are therefore unable to comment on its performance.</p>

Drainage

Repair category:	1
Notes	<p>There are no obvious defects affecting the foul or surface water drainage systems.</p> <p>Systems not tested. Underground drainage and manholes were not inspected. A limited surface visual inspection found no reportable items of disrepair.</p>

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories / porches	
Communal areas	
Garages and permanent outbuildings	1
Outside areas and boundaries	2
Ceilings	1
Internal walls	3
Floors including sub floors	3
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	
Electricity	2
Gas	
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 1 1

No immediate action or repair is needed.

Category 2 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 3 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes
3. Is there a lift to the main entrance door of the property?	No
4. Are all door openings greater than 750mm?	No
5. Is there a toilet on the same level as the living room and kitchen?	Yes
6. Is there a toilet on the same level as a bedroom?	Yes
7. Are all rooms on the same level with no internal steps or stairs?	No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

It is assumed that a Property Enquiry Certificate will be exhibited and that the property has a clear Title.

The exact extent of the boundaries should be confirmed by the Title Deeds.

In respect of any mutual boundaries, any shared maintenance liabilities or responsibilities require verification.

There is a river located close to the property. As of 6th May 2026 the online SEPA flood risk map indicates that there is a high river flood risk within approx a 25 metre distance from the property address. We have assumed there are no issues in this regard, that the property has never suffered from flooding and that insurance can be obtained on normal terms. Should any of these assumptions prove to be incorrect, it could impact on the value reported herein and future saleability of the property and we would recommend that further checks are made prior to purchase in this regard.

The Solicitor/Conveyancer must ensure that any prospective purchaser fully understands the nature, criteria and basis of a Home Report and in particular what a Home Report is and what it is not (an exhaustive Condition Report) This should be done before any prospective purchaser makes an offer for this property based on the content of this report. If the Solicitor or purchaser requires any clarification in relation to this they must contact the surveyor or familiarise themselves with the nature and criteria of this type of report.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialists or contractors advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

Estimated re-instatement cost (£) for insurance purposes

FIVE HUNDRED AND EIGHTY FIVE THOUSAND POUNDS £585,000

Valuation (£) and market comments

ONE HUNDRED AND SEVENTY THOUSAND POUNDS £170,000

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.

Report author:	Jennifer Swanson
Company:	Walker Fraser Steele
Address:	First Floor, Suite 1/3, Cadell House 27 Waterloo Street Glasgow G2 6BZ
Electronically Signed By:	Jennifer Swanson
Date of report:	06/05/2026



Mortgage Valuation

Case Details

Seller name(s):	Jamie McLean & Michaela McLean		
Address line 1:	Harbour Cottage		
Address line 2:	Shore Street		
Address line 3:			
Town / City:	Helmsdale	County:	
Postcode:	KW8 6JZ		
Date of inspection (dd/mm/yyyy):	05/05/2026		

Property Details

Property type:	House
Property style:	Detached
Was the property built for the public sector?	No

Specific details for: flats & maisonettes

Floor of property:	<input type="text"/>	Number of floors in block:	<input type="text"/>	Number of units in block:	<input type="text"/>	Lift available in block?	<input type="text"/>
--------------------	----------------------	----------------------------	----------------------	---------------------------	----------------------	--------------------------	----------------------

Tenure

Tenure:	Absolute Ownership
---------	--------------------

If Leasehold:

Unexpired term (years):	<input type="text"/>	Ground rent (pa):	£ <input type="text"/>
-------------------------	----------------------	-------------------	------------------------

Accommodation

No. of living room(s):	<input type="text" value="1"/>	No. of bedroom(s):	<input type="text" value="3"/>	No. of kitchen(s):	<input type="text" value="1"/>
No. of bathroom(s):	<input type="text" value="2"/>	No. of WC(s):	<input type="text" value="0"/>	No. of other room(s):	<input type="text" value="0"/>
Description of other room(s):	<input type="text"/>				
Floor area (m²):	<input type="text" value="131"/>	Floor area type:	<input type="text" value="External"/>		

Garages & Outbuildings

Garages / Parking space(s):	1 single garage.
Permanent outbuildings:	None.

Construction

Wall construction:	Solid Stone
Roof construction:	Pitched slate
Approximate year of construction:	1815
Any evidence of alterations or extensions?	No
Alterations or extension details:	<input type="text"/>

Risks

Is there any evidence of movement to the property?	Yes
If yes, does this appear longstanding?	Yes
Are there any further risk factors?	Yes
If yes, please provide details:	Evidence of movement was noted in the form of cracking at undercroft. This is believed to be longstanding and non-progressive. The property is believed to be at risk of flooding. The property may be at risk of asbestos.

Services

Electricity:	Mains	Gas:	None	Water:	Mains
Central heating:	Full	Drainage:	Mains		
Provide comments:	Oil fired boiler to rads				

Legal Matters

Are there any apparent legal issues to be verified by the conveyancer?	Yes
If yes, please provide details:	It is assumed that a Property Enquiry Certificate will be exhibited and that the property has a clear Title. The exact extent of the boundaries should be confirmed by the Title Deeds. In respect of any mutual boundaries, any shared maintenance liabilities or responsibilities require verification. There is a river located close to the property. As of 6th May 2026 the online SEPA flood risk map indicates that there is a high river flood risk within approx a 25 metre distance from the property address. We have assumed there are no issues in this regard, that the property has never suffered from flooding and that insurance can be obtained on normal terms. Should any of these assumptions prove to be incorrect, it could impact on the value reported herein and future saleability of the property and we would recommend that further checks are made prior to purchase in this regard. The Solicitor/Conveyancer must ensure that any prospective purchaser fully understands the nature, criteria and basis of a Home Report and in particular what a Home Report is and what it is not (an exhaustive Condition Report) This should be done before any prospective purchaser makes an offer for this property based on the content of this report. If the Solicitor or purchaser requires any clarification in relation to this they must contact the surveyor or familiarise themselves with the nature and criteria of this type of report.

Location

Location details:	The property is situated within a mainly residential area with an average level of local amenities.
-------------------	---


Roads

Road description:	The road has been adopted.
-------------------	----------------------------

General Remarks

The property is in a condition consistent with one of its age and type of construction with some elements in need of repair or replacement. The surrounding properties are of a similar age and type of construction.

It is recommended that a reputable timber/damp specialist firm be employed to carry out a detailed inspection of the entire subjects

 Mortgageability Remarks

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.

 Valuation

Market value in present condition:	£ 170000
Market value after essential repairs:	£ 175000
Insurance reinstatement value:	£ 585000
Retention required? <input checked="" type="checkbox"/> Yes Retention amount:	£ 5000

 Declaration

Surveyor name:	Jennifer Swanson
Surveyor qualifications:	MRICS
Report date (dd/mm/yyyy):	05/05/2026
Company name:	Walker Fraser Steele
Address:	First Floor, Suite 1/3, Cadell House 27 Waterloo Street Glasgow G2 6BZ
Telephone number:	01412210442
Email address:	Enquiries@walkerfrasersteele.co.uk
Surveyor signature:	

Energy
Performance
Certificate



Energy Performance Certificate (EPC)

Scotland

Dwellings

HARBOUR COTTAGE, SHORE STREET, HELMSDALE, KW8 6JZ

Dwelling type: Detached house
Date of assessment: 05 May 2026
Date of certificate: 05 May 2026
Total floor area: 110 m²
Primary Energy Indicator: 373 kWh/m²/year


Reference number: 0190-2375-7250-2706-0145
Type of assessment: RdSAP, existing dwelling
Approved Organisation: ECMK
Main heating and fuel: Boiler and radiators, oil

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£8,244	See your recommendations report for more information
Over 3 years you could save*	£1,857	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

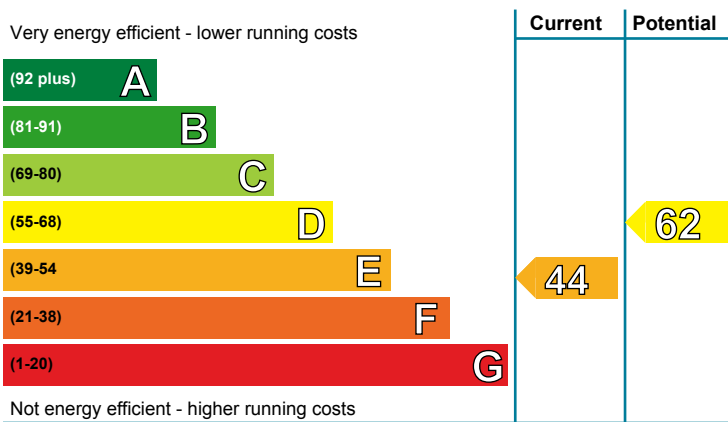


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (44)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

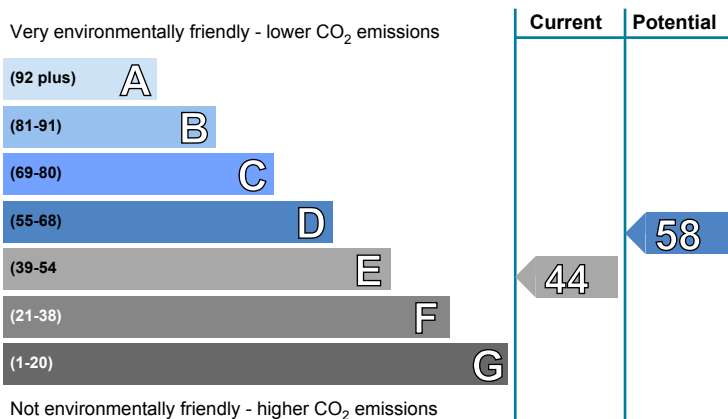

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (44)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal wall insulation	£7,500 - £11,000	£1236.00
2 Floor insulation (solid floor)	£5,000 - £10,000	£345.00
3 Heating controls (room thermostat)	£220 - £250	£276.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction. See the addendum section on the last page of this report for further information relating to items in the table.

Element	Description	Energy Efficiency	Environmental
Walls	Granite or whin, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 300 mm loft insulation Roof room(s), no insulation (assumed)	★★★★★ ★☆☆☆☆	★★★★★ ★☆☆☆☆
Floor	Solid, no insulation (assumed)	—	—
Windows	Fully double glazed	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, oil	★★★★☆☆	★★★★☆☆
Main heating controls	Programmer, TRVs and bypass	★★★★☆☆	★★★★☆☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	—	—
Hot water	From main system	★★★★☆☆	★★★★☆☆
Lighting	Below average lighting efficiency	★★★★☆☆	★★★★☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 80 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 8.8 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.









Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£6,903 over 3 years	£5,076 over 3 years	
Hot water	£1,056 over 3 years	£1,026 over 3 years	
Lighting	£285 over 3 years	£285 over 3 years	
Totals	£8,244	£6,387	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal wall insulation	£7,500 - £11,000	£412		
2 Floor insulation (solid floor)	£5,000 - £10,000	£115		
3 Upgrade heating controls	£220 - £250	£92		
4 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£225		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

3 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	22,465.41	N/A	N/A	N/A
Water heating (kWh per year)	2,671.93			

Addendum

When considering the PV installation consider installing PV battery and a PV diverter for water heating

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by ECMK (www.ecmk.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Jennifer Swanson
Assessor membership number: ECMK303576
Company name/trading name: Walker Fraser Steele
Address: 27 Waterloo Street
Glasgow
G2 6BZ
Phone number: 01412210442
Email address: jennifer.swanson@esurv.co.uk
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Property Questionnaire

property questionnaire

Property address	Harbour Cottage, Shore Street, HELMSDALE, KW8 6JZ
-------------------------	--

Seller(s)	Jamie McLean and Michaela McLean
------------------	----------------------------------

Completion date of property questionnaire	28/05/2026
--	------------

property questionnaire

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property? 5
2.	Council tax
	Which Council Tax band is your property in? B
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply) <ul style="list-style-type: none">● Garage Yes● Allocated parking space No● Driveway No● Shared parking No● On street Yes● Resident permit No● Metered parking No

property questionnaire

	● Other (please specify):	
4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	No

property questionnaire

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? <u>If you have answered yes</u> , please describe below the changes which you have made:	No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? <u>If you have answered yes</u> , please answer the three questions below:	No
	(i) Were the replacements the same shape and type as the ones you replaced?	
	(ii) Did this work involve any changes to the window or door openings?	
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	Yes Domestic Oil

property questionnaire

	<p><u>If you have answered yes or partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>							
	(i) When was your central heating system or partial central heating system installed? Circa 2011							
	(ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract:	No						
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year). N/A							
8.	Energy Performance Certificate							
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes						
9.	Issues that may have affected your property							
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it? <u>If you have answered yes</u> , is the damage the subject of any outstanding insurance claim?	No						
b.	Are you aware of the existence of asbestos in your property? <u>If you have answered yes</u> , please give details:	No						
10.	Services							
a.	Please tick which services are connected to your property and give details of the supplier:							
	<table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td> </td> <td> </td> <td> </td> </tr> </tbody> </table>	Services	Connected	Supplier				
Services	Connected	Supplier						

property questionnaire

	Gas or liquid petroleum gas	No	
	Water mains or private water supply	Yes	Scottish Water
	Electricity	Yes	SSE
	Mains drainage	Yes	Scottish Water
	Telephone	No	
	Cable TV or satellite	No	
	Broadband	Yes	Highland Broadband
b.	Is there a septic tank system at your property? <u>If you have answered yes, please answer the two questions below:</u>		Don't know
	(iv) Do you have appropriate consents for the discharge from your septic tank?		
	(v) Do you have a maintenance contract for your septic tank? <u>If you have answered yes, please give details of the company with which you have a maintenance contract:</u>		No
11.	Responsibilities for shared or common areas		
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?		No

property questionnaire

	<p><u>If you have answered yes, please give details:</u></p>	
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes, please give details:</u></p>	No
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	No
d.	<p>Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	Don't know
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p>	Don't know

property questionnaire

	<u>If you have answered yes</u> , please give details:	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) <u>If you have answered yes</u> , please give details:	No
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property? <u>If you have answered yes</u> , please provide the name and address, and give details of any deposit held and approximate charges:	No
b.	Is there a common buildings insurance policy? If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	No
c.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? <u>If you have answered yes</u> , please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	Don't know

property questionnaire

b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please give details:</p>	Don't know
c.	<p><u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work?</p> <p><u>If you have answered yes</u>, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	

14. Guarantees		
a.	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	No
(ii)	Roofing	No
(iii)	Central heating	No
(iv)	National House Building Council (NHBC)	No
(v)	Damp course	No
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No
b.	<u>If you have answered 'yes' or 'with title deeds'</u> , please give details of the work or installations to which the guarantee(s) relate(s):	

property questionnaire

c.	Are there any outstanding claims under any of the guarantees listed above? <u>If you have answered yes</u> , please give details:	No
15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years? <u>If you have answered yes</u> , please give details:	No
16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a.	advising that the owner of a neighbouring property has made a planning application?	No
b.	that affects your property in some other way?	No
c.	that requires you to do any maintenance, repairs or improvements to your property?	No
<u>If you have answered yes to any of a–c</u> above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.		

property questionnaire

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Seller(s) : **Jamie McLean and Michaela McLean**

Date: **28/05/2026**



Walker Fraser Steele Chartered Surveyors

For further information, please
call 0141 221 0442 or email
enquiries@walkerfrasersteele.co.uk

Walker Fraser Steele
First Floor
Suite 1/3 Cadell House
27 Waterloo Street
Glasgow
G2 6BZ